## X320/R320 Series "Quick Cal" Calibration Procedure



## SMART WEIGHING SOLUTIONS

## Notes:

Start with indicator powered on and in normal weighing mode. The indicator setup & build must be configured before performing the calibration routine. QCK.CAL option must also be enabled in SPEC menu.

_			
1	ZERO	Press & hold ZERO for 2 seconds to access QCK-CAL mode	9[1.[AL kg
		ZERO is displayed – then flashing live weight	ZE-D EDI DK
2	PRINT	Remove any weight from scale. Press PRINT to capture zero calibration	
		Calibrated live weight will be flashing	
3	ZERO	Press ZERO key to skip to SPAN calibration	GRP ITM SEL EST DK
	Add Weight	Add weights to scale at flashing screen -	GRP ITM SEE EET DA 9
4	PRINT	Press PRINT key to get to entry prompt Selected digit is flashing	03000kg
5	SELECT	Enter Weight Value:  Use the PRINT key to change digit Use the SELECT Key to move digit	OO IOO kg
6	<b>f</b>	Once correct weight value is showing press the F key	GRP ITM SEL EST OK
7	ZERO	After S. in P weight will be flashing Press the ZERO key to successfully exit Calibration	00 10.00 kg